

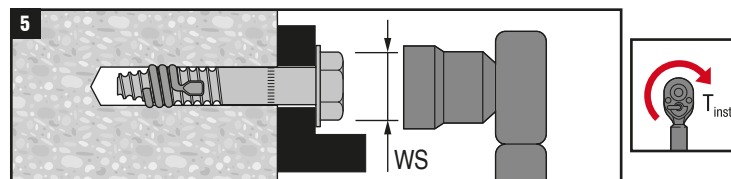
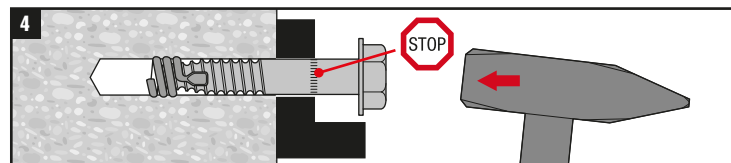

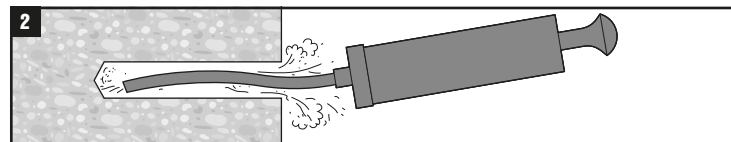


HCA	Ø d ₀ [inch]	t _{fix} [inch]	h ₁ [inch]	d _f [inch]
1/4 x 1 3/4		0 ... 3/8	2 - t _{fix}	
1/4 x 2 1/2	1/4	0 ... 7/8	2 3/4 - t _{fix}	5/16
1/4 x 3 1/2		0 ... 1 7/8	3 3/4 - t _{fix}	
3/8 x 2 1/4		0 ... 3/16	2 1/2 - t _{fix}	
3/8 x 3	3/8	0 ... 3/16	3 1/4 - t _{fix}	7/16
3/8 x 5		0 ... 0 3/16	5 1/4 - t _{fix}	
1/2 x 3		0 ... 1/4	3 1/4 - t _{fix}	
1/2 x 4	1/2	0 ... 1/4	4 1/4 - t _{fix}	9/16
1/2 x 5 1/2		0 ... 1 3/4	5 3/4 - t _{fix}	
1/2 x 7		0 ... 3 1/4	7 1/4 - t _{fix}	
5/8 x 3 1/2		0 ... 3/8	3 3/4 - t _{fix}	
5/8 x 5	5/8	0 ... 3/8	5 1/4 - t _{fix}	11/16
5/8 x 8		0 ... 0 3/8	8 1/4 - t _{fix}	
3/4 x 4 1/2		0 ... 1/4	4 3/4 - t _{fix}	
3/4 x 6	3/4	0 ... 1/2	6 1/4 - t _{fix}	13/16
3/4 x 10		0 ... 4 1/2	10 1/4 - t _{fix}	





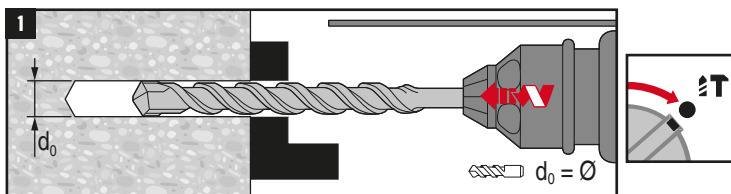


5.1	HCA [inch]	WS [inch]	t _{inst} [inch]
	Ø 1/4	7/16	10
	Ø 3/8	9/16	40
	Ø 1/2	3/4	80
	Ø 5/8	15/16	130
	Ø 3/4	1 1/8	180

2037829 A1-03.2014

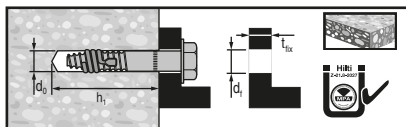

HCA	Ø d ₀ [mm]	t _{fix} [mm]	h ₁ [mm]	d ₁ [mm]
16 x 90	16	0...10	95 - t _{fix}	18
16 x 130		0...10	135 - t _{fix}	

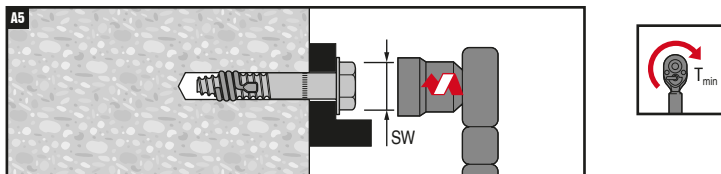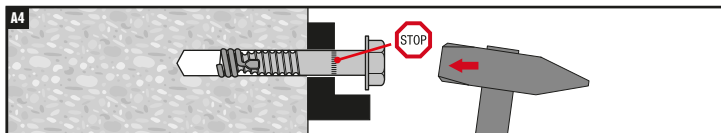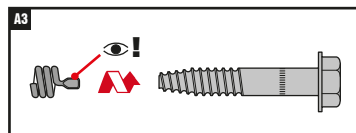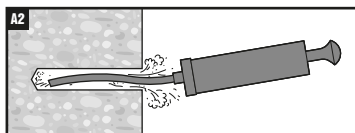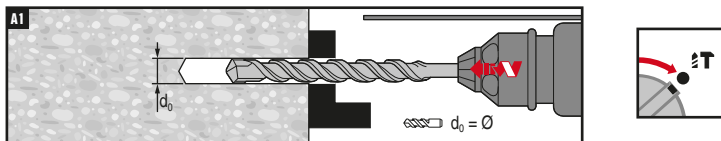

HCA [mm]	SW [mm]	t _{fix} [mm]	T _{min} [Nm]
Ø 16	24	10	180

